

Datasheet EE354

Dew Point Sensor down to -20 °C Td (-4 °F Td)



www.instromart.com Page 1 of 8

EE354

Dew Point Sensor down to -20 °C Td (-4 °F Td)

The compact EE354 sensor measures dew point temperature (Td) down to -20 °C (-4 °F) at a pressure up to 80 bar (1 160 psi). In addition the sensor provides data on frost point temperature (Tf) and volume concentration (Wv) and is ideal for monitoring compressed air networks and industrial drying processes.

Functionality and Reliability

The small size, robust stainless steel enclosure and wettable sensing element, combined with various process connections and accessories lead to best performance even in challenging measurement tasks.

Measurement Performance

The well proven E+E humdity sensing element enables excellent long term stability and resistance against pollutants, factors that minimize the EE354 maintenance needs and allow trouble-free operation.

Analogue and Digital Outputs

The Td, Tf and Wv measured data are available on the 4 - 20 mA analogue output and on the RS485 interface with Modbus RTU protocol. The wide scaling range of the analogue output simplifies the EE354 implementation in existing monitoring and control systems.

User Configurable and Adjustable

Using the free PCS10 Product Configuration Software and the adapter cable enables the configuration and adjustment of the EE355. The adapter cable is required for configuration on the PC and can be purchased separately.





www.instromart.com Page 2 of 8

Features

Configurable and adjustable

- Service interface
- Free PCS10
 Product Configuration Software

Enclosure

- IP65/NEMA 4X protection rating
- Stainless steel 1.4404

Measurement performance

- Dew point, frost point, volume concentration
- Dew point measurement range-20...+50 °C (-4...+122 °F)
- Accuracy ±1 °C (±1.8 °F)
- Condensation resistant

Outputs

- Current output 4 20 mA, wide scaling range
- Modbus RTU
- Industrial M12x1 connector

Process connection

- Stainless steel
- G 1/2" ISO or 1/2" NPT
- Pressure rating 80 bar (1 160 psi)

Inspection certificate

According to DIN EN 10204-3.1


www.instromart.com Page 3 of 8

Dimensions

Values in mm (inch)


ISO

G1/2"

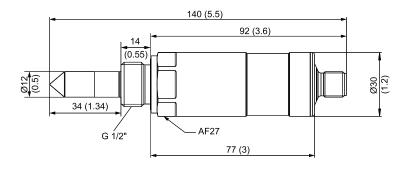

NPT


1/2"

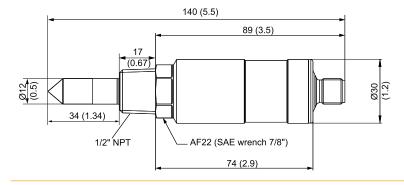

Technical Data

Measurands

Dew Point Temperature (Td)

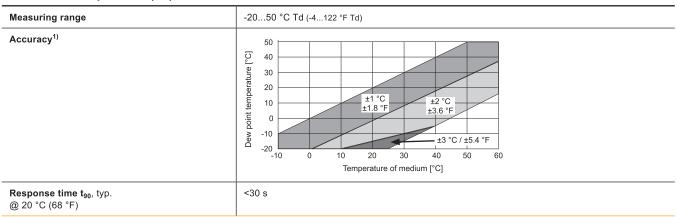

Traceable to intern. standards, administrated by NIST, PTB, BEV,...
 The accuracy statement includes the uncertainty of the factory calibration with an enhancement factor k=2 (2-times standard deviation). The accuracy was calculated in accordance with EA-4/02 and with regard to GUM (Guide to the Expression of Uncertainty in Measurement).

www.instromart.com Page 4 of 8

Technical Data

Measurands

Volume Concentration (Wv)

Measuring range @ 1013 mbar (14.7 psi)	1250125 000 ppm
Accuracy @ 20 °C (68 °F) and 1 013 mbar (14.7 psi)	±(50 ppm + 10 % of measured value)

Outputs

Analogue

Scalable output ¹⁾ Td, Tf or Wv	4 - 20 mA 3-wire	R _L < 500 Ω	R _L = load resistance
Max. configurable scaling	-40+80 °C Td (-40+176 °F Td)	0125 000 ppm	
Resolution	2 μΑ		

¹⁾ The EE354 simultaneously features an analogue current output and the RS485 interface.

Digital

Digital interface	RS485 (EE354 = 1 unit load)
Protocol	Modbus RTU
Factory settings ¹⁾	9600 Baud, parity even, 1 stop bit, Modbus address 243
Supported Baud rates	9600, 19200 and 38400
Measured data types	FLOAT32 and INT16

¹⁾ Find more details about communication setting in the User Manual and the Modbus Application Note at www.epluse.com/ee354.

General

Power supply class III (III) USA & Canada: Class 2 supply necessary	10 ¹⁾ - 28 V DC		
Current consumption, typ. @ 24 V DC	<20 mA + load current		
Electrical connection	M12x1, 5 poles, stainless steel 1.4404		
Filter Material	Stainless steel sintered		
Pressure working range	080 bar (01160 psi)		
Humidity working range	0100 %RH		
Temperature working range	-40+60 °C (-40+140 °F)		
Storage conditions	-40+60 °C (-40+140 °F) 095 %RH, non-condensing		
Enclosure Material Protection rating	Stainless steel 1.4404 (AISI 316L) IP65/NEMA 4X		
Electromagnetic compatibility	EN 61326-1 EN 61326-2-3 Industrial environment FCC Part15 Class B ICES-003 Class B		
Conformity	CE CA		
Configuration and adjustment	PCS10 Product Configuration Software (free download: www.epluse.com/pcs10) and configuration adapter		

^{1) 10} V + 0.02*R_L

www.instromart.com Page 5 of 8

Sampling Cells

Basic Sampling Cell

The basic sampling cell is suitable for the pressure range 0...64 bar (0...928 psi). It allows for easy installation of the dew point sensor into an existing or self-constructed sampling system.



HA050103 ISO / HA050105 NPT

Number	HA050103 ISO	HA050105 NPT
1	G 1/2"	1/2"
2	G 1/4"	1/4"
3	G 1/4"	1/4"

Sampling Cell with Quick Connector and Bleed Screw

The sampling cell is optimized for the pressure range 0...10 bar (0...145 psi). The air flow can be adjusted with the bleed screw. The G $\frac{1}{2}$ " ISO version features a quick connector suitable for standard DN 7.2 connection, which allows for the sampling cell to be mounted and removed without process interruption.





Number	HA050102 ISO	
1	G 1/2"	
2	Bleed screw	
3	Quick connection	



HA050107 NPT

Number	HA050107 NPT	
1	1/2"	
2	Bleed screw	
3	1/4"	

www.instromart.com Page 6 of 8

Ordering Guide

Feature	Description	Code
#		EE354-
Process connection	G 1/2" ISO thread	PA1
×	1/2" NPT thread	PA2
Accessories	No accessories	AC0
Ĕ	M12x1 cable mount connector, socket (plug)	AC2
Output 1 measurand	Dew point temperature Td [°C]	No code
<u>S</u>	Dew point temperature Td [°F]	MA53
tpr	Frost point temperature Tf [°C] (for Td > 0 °C output is Td)	MA65
	Frost point temperature Tf [°F] (for Td > 32 °F output is Td)	MA66
0.	Volume concentration Wv [ppm]	MA75
Output 1 scaling low	-20	No code
, and a second s	Value	SALValue
Output 1 scaling high	50	No code
	Value	SAHValue
Units (Modbus RTU)	Metric (SI)	No code
	Non metric (US/GB)	U2

Order Example

EE354-PA1AC0SAH20


Feature	Code	Description
Process connection	PA1	G 1/2" ISO thread
Accessories	AC0	No accessories
Output 1 measurand	No code	Dew point temperature Td [°C]
Output 1 scaling low	No code	-20
Output 1 scaling high	SAH20	20
Units (Modbus RTU)	No code	Metric (SI)

Accessories

For further information please refer to the Accessories datasheet.

Description	Code
Connection Cable M12x1 Socket 5 Poles / Free Cable Ends	HA010819 HA010820 HA010821
Modbus Configuration Adapter	HA011013
Sampling cell G 1/2" with quick connector	HA050102
Sampling cell NPT with bleed screw	HA050107
Basic sampling cell G 1/2"	HA050103
Basic sampling cell NPT	HA050105

www.instromart.com Page 7 of 8

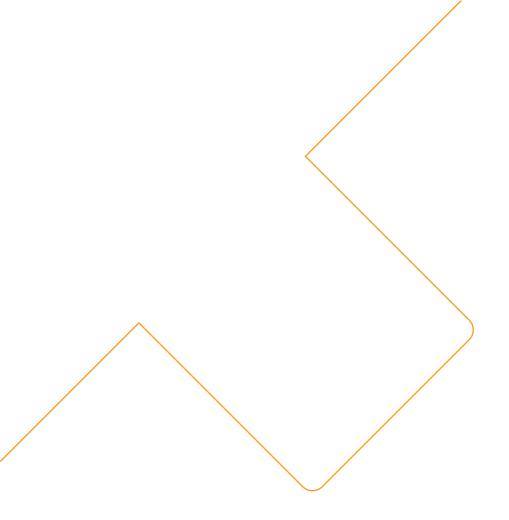



www.instromart.com Page 8 of 8